


## 2007-10 Nissan Altima Manifold Converters

### Cracking of the Original Equipment & Replacement Manifold Converter

- Subject:** Cracking or fracturing of the Converter body or welds.
- Model(s):** Nissan Altima's with 2.5L engines
- Year:** 2007-10 Using our part number 18258
- Cause(s):** Excessive torquing and stress on the Manifold Converter.
- Solution:** Deletion of the manifold stay and related components attaching to the outlet flange of the manifold Converter

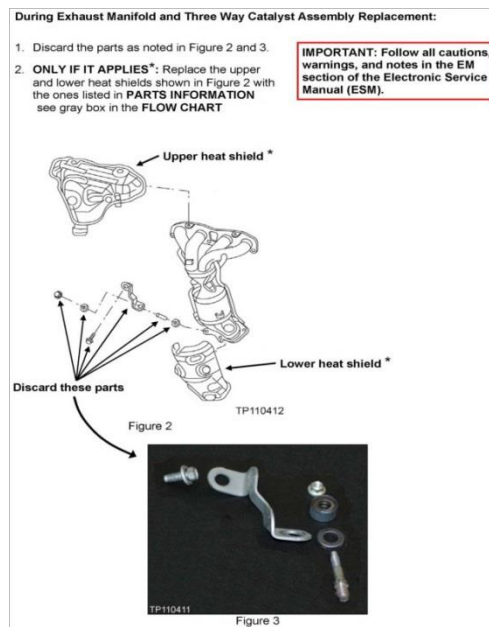

**Additional Help:** Available from Davico Technical Assistance at 800-422-6046  
Nissan Technical Service Bulletin: NTB12-120